
SSC-295

NONDESTRUCTIVE INSPECTION OF LONGITUDINAL STIFFENER BUTT WELDS IN COMMERCIAL VESSELS

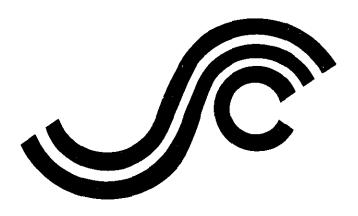

This document has been approved for public release and sale; its distribution is unlimited.

SHIP STRUCTURE COMMITTEE
1980

SHIP STRUCTURE COMMITTEE

The SHIP STRUCTURE COMMITTEE is constituted to prosecute a research program to improve the hull structures of ships and other marine structures by an extension of knowledge pertaining to design, materials and methods of construction.

RADM H. H. BELL (Chairman) Chief, Office of Merchant Marine Safety U. S. Coast Guard

Mr. P. M. PALERMO Deputy Director, Hull Group Naval Sea Systems Command

Mr. W. N. HANNAN Vice President American Bureau of Shipping Mr. M. PITKIN
Assistant Administrator for
Commercial Development
Maritime Administration

Mr. R. B. KRAHL Chief, Branch of Marine Oil and Gas Operations U. S. Geological Survey

Mr. C. J. WHITESTONE Chief Engineer Military Sealift Command

LCDR T. H. ROBINSON, U.S. Coast Guard (Secretary)

SHIP STRUCTURE SUBCOMMITTEE

The SHIP STRUCTURE SUBCOMMITTEE acts for the Ship Structure Committee on technical matters by providing technical coordination for the determination of goals and objectives of the program, and by evaluating and interpreting the results in terms of structural design, construction and operation.

U.S. COAST GUARD

CAPT R. L. BROWN
CDR J. C. CARD
CDR J. A. SANIAL, JR.
CDR W. M. SIMPSON, JR.

NAVAL SEA SYSTEMS COMMAND

Mr. R. CHIU Mr. R. JOHNSON Mr. J. B. O'BRIEN

AMERICAN BUREAU OF SHIPPING

DR. D. LIU MR. I. L. STERN

NATIONAL ACADEMY OF SCIENCES SHIP RESEARCH COMMITTEE

Mr. O. H. OAKLEY - Liaison Mr. R. W. RUMKE - Liaison

THE SOCIETY OF NAVAL ARCHITECTS & MARINE ENGINEERS

Mr. N. O. HAMAER - Liaison

WELDING RESEARCH COUNCIL

Mr. K. H. KOOPMAN - Liaison

U. S. MERCHANT MARINE ACADEMY

Dr. C.-B. KIM - Liaison

MILITARY SEALIFT COMMAND

MR. G. ASHE
MR. T. W. CHAPMAN
MR. A. B. STAVOVY (Chairman)
MR. D. STEIN

U. S. GEOLOGICAL SURVEY

MR. R. J. GIANGEPELLI MR. J. GREGORY

MARITIME ADMINISTRATION

MR. N. O. HAMMER
DR. W. MACLEAN
Mr. F. SEIBOLD
Mr. M. TOUMA

INTERNATIONAL SHIP STRUCTURES CONGRESS

Mr. S. G. STIANSEN - Liaison

AMERICAN IRON & STEEL INSTITUTE

Mr. R. H. STERNE - Liaison

STATE UNIVERSITY OF NEW YORK MARITIME COLLEGE

Dr. W. R. PORTER - Liaison

U. S. COAST GUARD ACADEMY

CAPT W. C. NOLAN - Liaison

U. S. NAVAL ACADEMY

Dr. R. BHATTACHARYYA - Liaison

Member Agencies:

United States Coast Guard Naval Sea Systems Command Military Sealift Command Maritime Administration United States Geological Survey American Bureau of Shipping



Address Correspondence to:

Secretary, Ship Structure Committee U.S. Coast Guard Headquarters, (G-M/TP 13) Washington, D.C. 20593

An Interagency Advisory Committee Dedicated to Improving the Structure of Ships

> APRIL 1980 SR-1249

For new merchant ship construction, nondestructive inspection of the hull, decks and bottom plating is normally required only for selected shell and deck plating butt welds. With the trend toward larger ships and lighter scantlings, the Ship Structure Committee became concerned that the weld inspection requirements might have to be extended to the longitudinal stiffeners of the vessel.

A project was undertaken to examine structural failure reports and evaluate if more inspection was needed and, if so, to recommend necessary procedures. This report addresses the subject. The survey did not discover significant failures of longitudinal stiffener butt welds and therefore does not recommend any additional testing or inspection.

Rear Admiral, U.S. Coast Guard Chairman, Ship Structure Committee

			160	nnicai Keport D	ocumentation Pag
1. Report No.	2. Government Acces	sion No. 3	3. Re	cipient's Catalog N	٥.
SSC-295					
Title and Subtitle		5	5. Re	port Date	
MONDECTRUCTIVE INCRECTION OF LONGITUDINAL CTIEFE			FERRIJARY 1980		
NONDESTRUCTIVE INSPECTION OF LONGITUE BUTT WELDS IN COMMERCIAL VESSELS		DINAL SITFFENER	6. Pe	rforming Organization	on Code
		8	8. Pe	rforming Organizatio	on Report No.
R. You	ushaw				
Performing Organization Name and Addre	35	1	10. w	ork Unit No. (TRAIS	5)
NAVAL SURFACE WEAPONS CENTER SILVER SPRING, MD 20910				·	
		11. (ontroct or Grant No. Z70099-6-71	
		<u> </u>		Ype of Report and P	
Sponsoring Agency Name and Address		······································	13. 1	ype of Keport and P	eriod Covered
U.S. Coast Guard			FINAL		
Office of Merchant Marine Safety					
Washington, D.C. 205		1	14. S	ponsoring Agency C	ode
				G-M	
Supplementary Notes			-		
Performed for the in	tanagangu Chin	Staustuma Commi	:++^	^	
reflormed for the fir	ceragency simp	Structure commit	1666	C	
major shipbuilders, evidence of structur at this time to expantly type of weld joint.	al failure in	service and, the	eref	ore, no need	1
17. Key Words		18, Distribution Stateme	ent		
Welds		Document is available to the U.S. Public			
Longitudinal Stiffener Hull Plating		through the National Technical			
Structural Failure		Information Service, Springfield,			
Nondestructuve In		VA 22161			
9. Security Classif, (of this report)	20. Security Clas	sif. (of this name)		21. No. of Pages	22. Price
Unclassified	l l	lassified		6	
UIIC (0.5.5) ICU	I UIIC	143311164	- 1	•	İ

Approx

When Yo

mitti

cent

mete

mela

kilo

squa

squa

hecta

kilog

milli

liters

liters

liters

cubic

cubic

Cals

af -40

-40 C

Symbol

cm² m² km²

ha

kg

ml

լ ա3 ու3

"C

Įν

^{*3} in 1 2.54 (exactly), for other exact conversions and own detailed lables, see NBS Misc. Publ. 286, Units of Weights and Measures, Price \$2.25, SD Catalog No. C13.10:286.

CONTENTS

	PAGE	
	1	
INTRODUCTION	1	
OBJECTIVE AND SCOPE	2	
LONGITUDINAL STIFFENERS		
CASUALTY REPORTS	2	
CONSIDERATIONS RELATING TO NAVAL ARCHITECHTURE	2	
A SURVEY OF MAJOR SHIPBUILDING FACILITIES	4	
CONCLUSIONS AND RECOMMENDATIONS		
	5	
REFERENCES		
LIST OF FIGURES		
	PAGE	
FIG. 1 - CROSS SECTIONAL CONFIGURATIONS OF TYPICAL LONGITUDINAL STIFFENERS	3	

INTRODUCTION

For new merchant ship construction, there are requirements for quality assurance for hull and deck plating butt welds it however, there are no such requirements for the welds which join together the sections of longitudinal stiffeners. It has been suggested that there may be a need for quality assurance here also. The reasoning in favor of nondestructively inspecting these weld joints is that to be considered effective in resisting hull bending, longitudinals on shell, decks, longitudinal bulkheads, etc., must be continuous while the requirement for continuity strongly suggests a need for Nondestructive Testing (NDT), there are additional considerations.

Modern steel vessels contain literally miles of welds which bear load and for which a rationale can be constructed supporting a need for NDT; but to do NDT on all such welds would be prohibitively expensive. As a consequence, the builders of ships, the owners, and the regulatory agencies have devised schemes whereby what NDT is to be done will be concentrated on those weld joints which experience has proven to be subject to the most severe stresses, primarily the hull plating butt welds.

Any NDT applied to joints elsewhere would involve either some substitution of inspection locations or added cost of fabrication. Either of these alternatives would be a major consideration to the shipbuilding industry and changes in present procedure should not be initiated without technical facts supporting that position.

The Naval Surface Weapons Center contracted to research this subject and make recommendations. This report describes the results of that work.

OBJECTIVE AND SCOPE

The objective of this task has been to determine if there is a need for nondestructive inspection of the welds which join the sections of longitudinal stiffeners. This was to be done by reviewing available marine casualty reports and surveying the major shipbuilders to ascertain if the weld joints in question have a history of failure, and by consultation with naval architects to determine the load-bearing requirements for longitudinal stiffeners.

If it were determined that nondestructive testing should be done, then recommendations were to be made regarding methods, procedure, acceptance, criteria, etc. Such recommendations would reflect the current state-of-the-art of NDT.

LONDITUDINAL STIFFENERS

There are two general types of ship construction employing stiffeners: londitudinally framed and transversely framed. This study was limited to longitudinally framed ships and to four specific cross-sectional configurations: i.e., "L", "T", "H", and flat bar, Figure 1. Although the configurations differ, in each case continuity is achieved by a butt weld between sections. Without exception, these butt welds are specified for full penetration. The sections are ordinarily twenty feet or longer. Thickness may be as little as 1/4 inch, or as great as an inch or more.

While there may be cases where only one side of the weld is accessible, in most instances both faces of the weld are accessible.

CASUALTY REPORTS

It was determined that the U. S. Coast Guard does have a file of casualty reports. The United States Salvage Association, Inc. does not and the records kept by the American Bureau of Shipping are not suited to a search for specific structural member failure.

The U. S. Coast Guard maintains a record of structural failure casualties. Since 1963 a total of 897 cases have been categorized and incorporated into a computer program. Using the key words, "structural failure", "steel welds", "fractured plates and internals", and "fractured welds" only 88 possible cases were uncovered for use in this study. A careful review of these 88 reports revealed that none of these cited a fracture of the type of weld joint pertinent to this study.

Through letter inquiry it was learned from the America Bureau of Shipping that they have no evidence of structural problems relating to butt welds in longitudinal stiffeners.

CONSIDERATIONS RELATING TO NAVAL ARCHITECTURE

Longitudinals are normally made continuous in order to assure their effectiveness in resisting bending of the hull girder and classification societies include them in calculating the hull girder section modulus. In regard to weld discontinuities, the naval architect assumes that the weld joint is at least as strong as the parent metal of the stiffeners. This assumption necessitates full penetration welding and does not allow for welding flaws except within the framework of an added safety factor. Containerships are a special case. Since there is relatively little deck, the strength ordinarily provided by that member is designed into large box girders on each side of the ship and quality assurance is especially important.

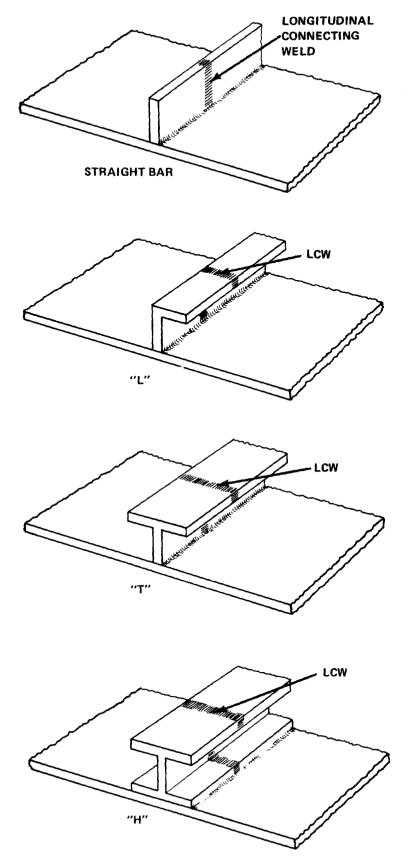


FIGURE 1 CROSS SECTIONAL CONFIGURATIONS OF TYPICAL LONGITUDINAL STIFFENERS

Certain other types of ships have a longitudinal girder incorporated into the deck which functions there as does the keel in the hull. These also are longitudinals with requirements for continuity.

A SURVEY OF MAJOR SHIPBUILDING FACILITIES

It was specifically requested that the major shipbuilders be contacted in regard to this task and pursuant to that request, a survey was conducted which included visits to five major shipbuilders. From this survey, it was learned that failure in service of these type joints is "very" infrequent and consequently very little NDT is done except for containerships. When NDT is done on the longitudinal joints, it is usually because such inspection has been requested by the owner. However, the shipbuilders do some NDT just to encourage and maintain good workmanship.

Since these are full penetration joints, radiography and ultrasonics are the methods used to determine interior integrity. Ultrasonics (UT) is most commonly used because of lower cost and ease of application.

Usually, the acceptance criteria is the same as that used when evaluating hull welds. In one case, the ultrasonic acceptance criteria was modified to permit "slightly" longer discontinuity length but with the signal amplitude criteria unchanged.

Direct costs would be unchanged if NDT of these joints were to be substituted for some other hull weld inspection. If, however, this type NDT were to be done in addition to the current amount of weld inspection, then there would be an increase in inspection costs at a rate equivalent to what is now charged per joint in hull weld NDT.

The box-girder type construction found in containerships is a special case and is extensively inspected primarily with UT. The procedure and acceptance criteria used is the same as that for butt welds in hull plating.

CONCLUSIONS AND RECOMMENDATIONS

Based upon the review of the Coast Guard Casualty Reports and the survey of the major shipbuilders, it is concluded that there is not at this time any serious problem regarding the welds which join together the sections of longitudinal stiffeners. Accordingly, it is recommended that the present practice be continued whereby the funds available for NDT are concentrated on those weld joints known to be subject to severe stress.

The containership is a special case and merits nondestructive testing of all butt welds in the box girder construction to provide assurance of proper weld quality. Present practice appears adequate.

It should be noted, however, that the longitudinal stiffeners are load-bearing members and that there is a technical requirement for continuity. If, in the future, evidence is found that these type joints are failing in service, then the preceding conclusions and rationale should be revised.

If future experience does produce a need for nondestructive testing of these weld joints, the procedure and acceptance criteria used on hull butt welds could be used.

REFERENCES

- Rules for Building and Classing Steel Vessels, 1979
 American Bureau of Shipping, 65 Broadway, New York, NY
- Principles of Naval Architecture; Society of Naval Architects and Marine Engineers, 74 Trinity Place, New York, NY, Page 182.
- 3. Coding Instructions for Commercial Vessel Casualties (As amended FY 1976); U. S. Coast Guard, Washington, DC.

SHIP RESEARCH COMMITTEE Maritime Transportation Research Board National Academy of Sciences - National Research Council

The Ship Research Committee has technical cognizance of the interagency Ship Structure Committee's research program:

Mr. O. H. Oakley, Chairman, Consultant, McLean, VA

Prof. A. H.-S. Ang, Civil Engineering Dept., University of Illinois, Champaign, IL

Mr. M. D. Burkhart, Consultant, Clinton, MD

Dr. J. N. Cordea, Senior Staff Metallurgist, ARMCO INC., Middletown, OH

Mr. D. P. Courtsal, Vice President, Dravo Corporation, Pittsburgh, PA

Mr. W. J. Lane, Consultant, Baltimore, MD

Mr. A. C. McClure, Alan C. McClure Associates, Inc., Houston, TX

Dr. W. R. Porter, Vice President for Academic Affairs, State Univ. of New York Maritime College

Prof. H. E. Sheets, Dir. of Engineering, Analysis & Technology, Inc., Stonington, CT

Mr. R. W. Rumke, Executive Secretary, Ship Research Committee

The Materials, Fabrication, & Inspection Advisory Group prepared the project prospectus, evaluated the proposals for this project, provided the liaison technical guidance, and reviewed the project reports with the investigator:

- Dr. J. N. Cordea, Chairman, Senior Staff Metallurgist, ARMCO Inc., Middletown, OH
- Mr. W. C. Brayton, Consultant, Boca Raton, FL
- Mr. W. Dukes, Chief Engineer for Structures, Bell Aerospace Textron, New Orleans, LA
- Dr. W. C. Leslie, Dept. of Materials & Met. Engrg., Univ. of Michigan, Ann Arbor, MI
- Mr. P. W. Marshall, Senior Staff Civil Engr., Shell Oil Co., Houston, TX
- Prof. P. F. Packman, C'man, Dept. of Civil & Mech. Engrg., Southern Methodist

University, Dallas, TX

Dr. E. J. Ripling, President, Materials Research Lab., Inc., Glenwood, IL

SHIP STRUCTURE COMMITTEE PUBLICATIONS

These documents are distributed by the National Technical Information Service, Springfield, VA 22161. These documents have been announced in the Clearinghouse Journal U. S. Government Research & Development Reports (USGRDR) under the indicated AD numbers.

- SSC-281, Bibliography for the Study of Propeller-Induced Vibration in Hull Structural Elements by O. H. Burnside and D. D. Kana. 1978. AD-A062996.
- SSC-282, Comparison of Stresses Calculated Using the DAISY System to Those Measured on the SL-7 Containership Program by H. Y. Jan, K. T. Chang, and M. E. Wojnarowski. 1979. AD-A069031.
- SSC-283, A Literature Survey on the Collision and Grounding Protection of Ships by N. Jones. 1979. AD-A069032.
- SSC-284, Critical Evaluation of Low-Energy Ship Collision-Damage Theories and Design Methodologies Volume I Evaluation and Recommendations by P. R. Van Mater, Jr., and J. G. Giannotti. 1979. AD-A070567.
- SSC-285, Critical Evaluation of Low-Energy Ship Collision-Damage Theories and Design Methodologies Volume II Literature Search and Review by P. R. Van Mater, Jr., and J. G. Giannotti. 1979. AD-A070568.
- SSC-286, Results of the First Five "Data Years" of Extreme Stress Scratch Gauge Data Collection Aboard Sea-Land's SL-7's by R. A. Fain and E. T. Booth. 1979. AD-A072945.
- SSC-287, Examination of Service and Stress Data of Three Ships for Development of Hull Girder Load Criteria by J. F. Dalzell, N. M. Maniar, and M. W. Hsu. 1979. AD-A072310.
- SSC-288, The Effects of Varying Ship Hull Proportions and Hull Materials on Hull Flexibility Bending and Vibratory Stresses by P. Y. Chang. 1979. AD-A075477.
- SSC-289, A Method for Economic Trade-Offs of Alternate Ship Structural Materials by C. R. Jordan, J. B. Montgomery, R. P. Krumpen, and D. J. Woodley. 1979. AD-A075457.
- SSC-290, Significance and Control of Lamellar Tearing of Steel Plate in the Shipbuilding Industry by J. Sommella. 1979. AD-A075473.
- SSC-291, A Design Procedure for Minimizing Propeller-Induced Vibration in Hull Structural Elements by O. H. Burnside, D. D. Kana, and F. E. Reed. 1979. AD-A079443.
- SSC-292, Report on Ship Vibration Symposium '78 Sheraton National Hotel, Arlington, VA. by E. Scott Dillon. 1979 AD-A079291
- SSC-293, Underwater Nondestructive Testing of Ship Hull Welds by R. Youshaw and C. Dyer. 1979. AD-A079445.
- SSC-294, Further Survey of In-Service Performance of Structural Details by C. R. Jordan and L. T. Knight. 1980.